 © Quin Global UK Ltd. 2024

CONTACT ADHESIVE

GEKKO®
FLOORING ADHESIVES

G56

NON CHLORINATED PREMIUM HIGH GRAB CONTACT ADHESIVE


- **Dichloromethane Free**
  Non Chlorinated Formulation.
- Superior Coverage.
- Fast drying with a long open time.
- High grab, high strength formulation.
- Versatile adhesive suitable for use with a variety of substrates.
- Eurofins IACG Tested – Meets the VOC emissions requirements of EC1+



DICHLOROMETHANE FREE

TESTED AND APPROVED SP101 Flooring Plywood

TECHNICAL DATA

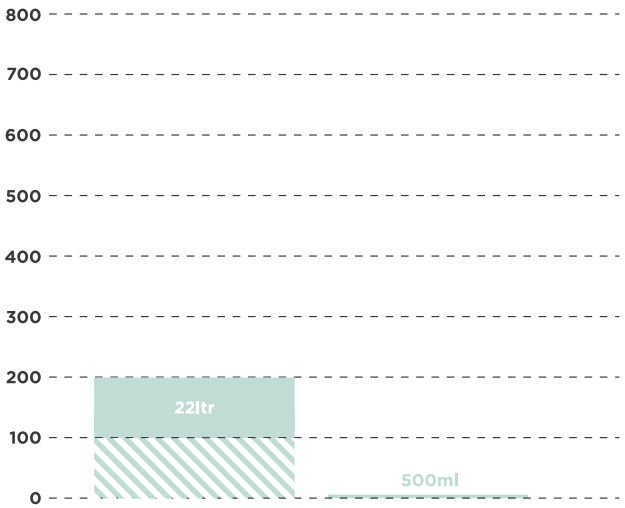

SQUARE METRE COVERAGE (m²)*:

	22ltr	500ml
Single-sided	200m²	n/a
Double-sided	100m²	4m²

APPLICATION TYPE:
Double-sided

FLASH OFF TIME:**
2 - 3 mins

OPEN TIME:**
35 mins

COLOUR:
Clear

ADHESIVE TYPE:
SBR

GUN TYPE:
Pro Gun

HOSE TYPE:
Rubber

VALVE:
6501

SPRAY TYPE:
Web

*consult the Spray Manual for a more detailed tutorial on the bonding process.
**depending on environment & ambient temperature.

 © Quin Global UK Ltd. 2024

PRODUCT OVERVIEW

Gekko G56 is a premium SBR based sprayable contact adhesive designed to be applied as a double sided adhesive to recommended substrates and subfloors. Ideal for demanding applications and bonds under pressure. Installations include the fixing of carpets and other floorcoverings to ply, hardboard, chipboard, OSB, latex screeds, cement, concrete, steel raised access and plaster board.

Not suitable for use with flexible PVC, expanded polystyrene and vinyl.

CHEMICAL TECHNICAL DATA

Colour	Clear
System Flammability	Flam Adhesive /Flam Propellant
Consumption	15-20 g/m²
Ready for foot traffic after	30 mins
Final strength after	24 hours
Flash-off Time	2-3 mins depending on atmospheric conditions.
Open Time	35 mins when protected from contaminants.
Shelf Life	18 months from date of manufacture

COVERAGE



LIGHT COVERAGE MEDIUM COVERAGE HIGH COVERAGE

Coverage for this product is calculated on high coverage, average 15-20 grams per s/m²

Any less will result in reduced bond strength and/or bond failure.

HANDLING & STORAGE OVERVIEW

- For full handling and storage details consult Safety Data Sheet section 7.
- For optimum performance, store at 18°C during use.
- Shake well before use.
- Do not store below 10°C.
- Do not allow the product to freeze.
- Do not store directly on concrete floor.
- Do not store at temperatures over 50°C
- Avoid exposure to direct sunlight.
- Do not use in confined spaces without adequate ventilation and/or respirator.
- For full PPE information, consult Safety Data Sheet section 8.

PRE-BONDING INFORMATION

Prior to use, check compatibility by spraying a small test patch of the adhesive on the substrate or subfloor in use. Consult both MSDS and TDS documents.

When working with absorbent materials a higher coat weight is recommended.

Full product matrix available at www.gekko-adhesives.com.

ALWAYS READ THE LABEL.

SURFACE PREPARATION

- Proper subfloor preparation is essential for the correct installation of any floorcovering.
- Before bonding ensure subfloors are structurally sound, smooth and dry (<75% RH). Subfloors must be free from dirt, dust, oil, loose paint, wax or grease etc. Any contaminants may affect adhesion.
- For best bonding results, the adhesive temperature range should be between 10°C - 27°C. Optimum temperature is 18°C.

DIRECTIONS FOR USE

- This product is designed to be applied as a double sided adhesive to recommended substrates and subfloors, see Product Matrix.
- Ensure any pre-bonding, testing and surface preparation is complete.

CANISTER DIRECTIONS FOR USE

- Attach and secure hose tightly onto the spray gun with required tip as per the set up guide.
- Spray 4" – 8" away from the subfloor at a 90 degree angle to the surface, applying a uniform, even coat of adhesive to obtain 80% to 100% coverage of the surface.
- If necessary, another coat of adhesive may be applied in areas that appear to require more adhesive.
- When working with absorbent materials, stair trends and risers or with perimeter fixing both a higher coat weight and double-sided application is recommended.
- **Please note that a higher coat weight will reduce overall coverage.**
- Allow 2 - 3 minutes flash off time for the adhesive to tack off, temperature may affect drying times so ensure adhesive is touch dry before installing floor coverings.
- Bring surfaces together with adequate pressure to form the bond, a roller is recommended to apply a uniform pressure to achieve maximum bond strength.
- Allow 24 hours for the adhesive to fully cure.
- If the spray tip clogs, unscrew the spray tip from the gun and consult canister maintenance & storage after use.
- Do not use a pin on the spray tip.

GEKKO
A Vola Group brand
Manufactured by Quin Global UK Ltd
Unit 1 Ruthvenfield Avenue,
Perth, PH1 3WB, United Kingdom
T +44 (0)1738 494 919

 © Quin Global UK Ltd. 2024

AEROSOL DIRECTIONS FOR USE

- **SHAKE WELL BEFORE USE**
- Spray 4" – 8" away from the subfloor at a 90 degree angle to the surface, applying a uniform, even coat of adhesive to obtain 80% to 100% coverage of the surface.
- If necessary, another coat of adhesive may be applied in areas that appear to require more adhesive.
- When working with absorbent materials, stair trends and risers or with perimeter fixing both a higher coat weight and double-sided application is recommended.
- **Please note that a higher coat weight will reduce overall coverage.**
- Allow 2 - 3 minutes flash off time for the adhesive to tack off, temperature may affect drying times so ensure adhesive is touch dry before installing floor coverings.
- Bring surfaces together with adequate pressure to form the bond, a roller is recommended to apply a uniform pressure to achieve maximum bond strength.
- Allow 24 hours for the adhesive to fully cure.
- If the aerosol spray nozzle clogs, turn the can upside down and press the nozzle until a small amount of propellant is expelled to clear the blockage.

CANISTER SETUP



STEP 1
Attach and secure the hose tightly to the spray gun with the required tip. Screw the hose to the canister valve (A). Make sure the hose-valve connections are securely tightened. Open the valve slowly (B), and a rush of pressure will go through the hose.



STEP 2
Unlock the trigger on the spray gun using the locking screw. Pull the trigger on the gun to purge the adhesive through.



STEP 3
Adjust the spray pattern width of the gun by rotating the locking screw behind the trigger 1 turn at a time.



STEP 4
After spraying, lock the trigger using the locking screw. **Do not turn the canister off at the valve.**


CANISTER MAINTENANCE & STORAGE AFTER USE



STEP 1
When the canister is not in use, close it by rotating the locking screw in a clockwise direction.



STEP 2
Do not close the canister while the hose is connected. Turning the valve to an off position will cause the system to lose pressure in the hose and gun, resulting in adhesive curing in the hose.




STEP 3
Remove the tip by undoing the nut. Clean the tip thoroughly with a suitable solvent cleaner.



STEP 4
Replace the tip and use the canister as previously directed.

CANISTER CHANGEOVER




STEP 1
Turn valve on canister into the off position.



STEP 2
Spray out remaining adhesive left in the hose.



STEP 3
Disconnect the spray hose and gun from the canister.



STEP 4
Connect to the new canister as per the Set Up Guide.

CANISTER CLEANING

Before reconnecting the spray hose to a new canister, connect to a canister of cleaning solvent (sold separately) and spray out until liquid is clear which indicates that the hose and gun is clean.

GEKKO
A Vola Group brand
Manufactured by Quin Global UK Ltd
Unit 1 Ruthvenfield Avenue,
Perth, PH1 3WB, United Kingdom
T +44 (0)1738 494 919

bsi LRQA CERTIFIED UKAS MANAGEMENT INVESTORS IN PEOPLE Silver INVESTORS IN YOUNG PEOPLE GOOD PRACTICE AWARD

 © Quin Global UK Ltd. 2024

ATTENTION

If you choose to leave the hose and spray gun on the empty canister, leave the valve on the canister **open**. Do not disconnect the hose/gun from the canister until reconnection or cleaning takes place. Always close and lock the spray gun.

REMOVAL OF ADHESIVE

To remove wet adhesive overspray, apply a solvent based cleaning product to the surface or to a rag and wipe away. Use warm soapy water to remove cleaner residue if required.

In the instance of dried adhesive it may be necessary to remove via an abrasive if the adhesive cannot be softened.

Wherever possible, protect areas of potential overspray.

CAUTION

ALWAYS USE WITH ADEQUATE VENTILATION.

For Full PPE Information Consult SDS (Safety Data Sheet) Section 8.


Whenever possible we recommend shaking the canister well before use.

CANISTER DISPOSAL




STEP 1

Detach the gun and hose.




STEP 2

Lay the empty canister on its side with the valve pointing **away** from people, and well away from sources of ignition.



STEP 3

Open the canister valve (anti-clockwise) and release any residual pressure.



STEP 4

Stand the canister upright. Use a hammer, brass punch, or other non-sparking instrument to puncture the friable disc.

Contact sales.uk@quinglobal.com to take advantage of our recycling facility or alternatively disposed of your canister as per your normal scrap metal disposal (subject to local waste restrictions).

AEROSOL DISPOSAL



Disposed of the can as per your normal recycling process (subject to local waste restrictions).



WARNING

Do not pierce or burn even after use.

SUBSTRATES

	DCM Free	PVC Profiles	Wall Cladding	PU Underlay	Rubber Crumb Underlay	Rubber Floorcoverings	Linoleum (Marmoleum)	Sheet Vinyl / Vinyl Tile	LVT	LVT / SPC Loose Lay	Cushion Vinyl - Foam Back	Cushion Vinyl - Felt Back	Carpet - Gel back	Carpet - Felt Back
CARPET SPRAY														
G56	●		●	●									●	●

SUBFLOORS

Carpet - Action Back	Carpet - Fibre Bonded	Carpet Tile - Bitumen Back	Carpet Tile - PVC Back	Carpet Tile - Cushion Back	Flooring Grade Ply	Hardboard	Chipboard	OSB Board	Laytex Screed	Concrete / Sand & Cement	Calcium Sulphate - Anhydrite Screeds	Non-absorbant - Ceramic	Steel - Raised Access	Plaster Board	EPS - Insulation Board
●	●			●	●	●	●	●	●	●	●		●	●	

WARNING: Site conditions vary, to ensure this product is suitable and to confirm this data sheet is current please visit www.gekko-adhesives.com.

GEKKO
A Vola Group brand
Manufactured by Quin Global UK Ltd
Unit 1 Ruthvenfield Avenue,
Perth, PH1 3WB, United Kingdom
T +44 (0)1738 494 919

bsi LRQA CERTIFIED UKAS MANAGEMENT 0003 INVESTORS IN PEOPLE | Silver INVESTORS IN YOUNG PEOPLE GOOD PRACTICE AWARD